Ferry Maintenance Report - Queen of Oak Bay

Date: March 16, 2017



Reporter: William Glatt Staff: William Glatt & Ian Beliveau

Ship's crew: Chief Engineer Irik Mallie

Reason for Visit

- Regular instrument benchmarks
- Install new Air Separator
- Install new power supply and RS485 Converters

Observations (important highlighted in red

Actions Taken

- System was observed while running (noted frequency of bubbles visible in TSG)
- System was shut down and instruments were removed for benchmarking and cleaning
- The Caleffi Air Separator (551006A) was installed in the system just after the Sea strainer.
- Instruments were replaced, system powered back on and checked for leaks
- Frequency and size of bubbles appeared to decrease. Further observation required
- The SAS was inspected on the fore deck, RS485 Converter was replaced.
- SAS lenses were cleaned with alcohol and kimwipes
- Proceeded to the top of Bridge #2, and began replacing the SAS power supplies
- When power was restored to SAS it was observed to rotate approx. 90o inboard and pointed at the car deck of the vessel
- The serial data connection to SAS was tested via terminal and communications were established
- Time limited further troubleshooting, enclosures were resealed

Future Actions

Waiting for R59681 hygroscopic safety vent via Wolseley

Install abrasion protection for Tygon tubing penetrating deck plates

Continue observations for Alberni bubble issues

Ferry Maintenance Report – Queen of Oak Bay

Have an additional POD machined and plan a diver inspection if bubbles persist

Pictures



























